




since 1907

Date : 23.03.2011 - Airjet reed serial number 20112345/2

AIRFLOW PROTOCOL


29/03/2011

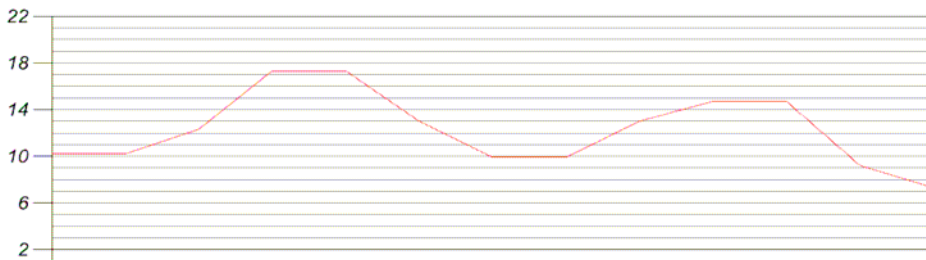

Step 1
 Received reed from customer the 22.03.2011. Reed airflow inspection before cleaning the reed to check conditions of reed efficiency .

AIRFLOW PROTOCOL


29/03/2011

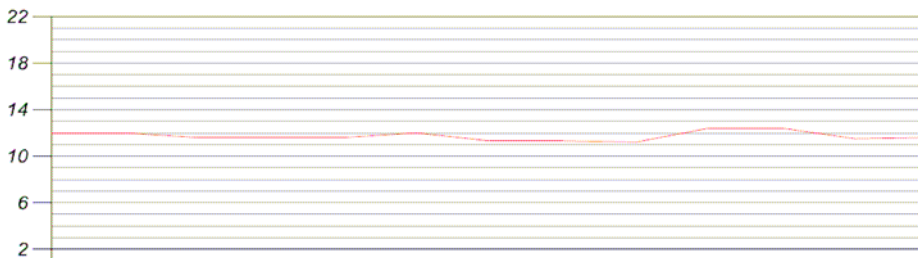

Step 2
 Reed airflow inspection after cleaning the reed by ultrasonic reed cleaning machine.

AIRFLOW PROTOCOL

29/03/2011

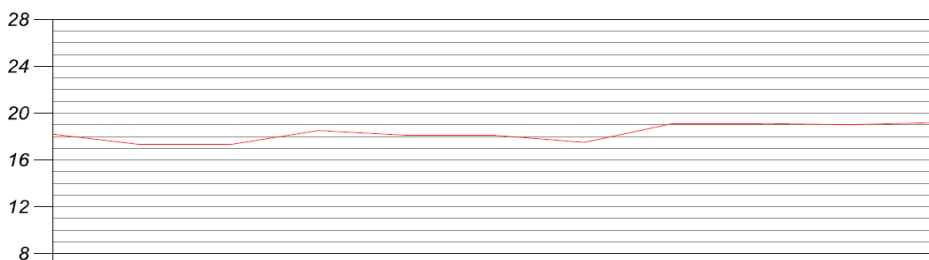

Step 3
 Reed airflow retuning according to loom type. Pressure was too low. (Step 2 +-12 Mbar) Has been corrected to ideal pressure value (Step 3 +- 18 Mbar)